Whittington Hospital NHS Trust DDCA Action Plan

	Action No.	Risk (Responsibility) Probability and Impact Criteria Values								
Ref		JAS FM/WFL		High Mediu	1		Action		Review Da	te
	Flashring Custome	575110,012	ITUSE	Ingli Wedia		50016			_	
1	Electrical Systems Fault tripping occurs when the generator is tested on load. JAS FM working with Trust to resolve these issues					18		Dec '08		
2	Trust local rules: Disconnection certificates are provided by the Trust, it was reported by JAS FM that this was not always possible					12			Nov '08	1
3	JAS FM arranged local shutdowns for 5 year electrical testing by local agreement not all completed					12			Nov '08	
4	L Block O&M manuals (electrical) were not up to date.					12		D 100	Nov '08	
5	Modifications on circuits and room numbering had taken place and this has meant that the circuit identification labels were in correct in L Block Plant records and Permits to Work, Logs, in AP's folder? Not Presented.					18 12		Dec '08	Nov '08	+
7	No commissioning or orientation training undertaken					12			Nov '08	
8	Main incoming supply is very difficult to test. Due to operational constraints.					12			Nov '08	
9	On the 5 yearly test sheets the contractor reported that they were "Unable to locate circuits."				_	12			Nov '08	
10 11	Following recent 5 yearly electrical tests in L Block a number of (Category 1 & Category+B152) the defects still remain Generic risk assessments only				-	12 12			Nov '08 Nov '08	
12	Or calibration certificates for instruments					12		Dec '08		
13	Panel charts indicate 45 Amp live circuits with "unable to locate "in level 4 corridor					18		Dec '08		
14	New wire armoured cable penetration not fire stopped				_	18		Dec '08		<u> </u>
15	L Block Main LV Switch panel – Hoare Lea, Survey Report 21 st June 2007 still outstanding remedial works				_	12			Nov '08	
16	'To undertake a detailed inspection of all internal parts to establish the integrity of the LV switchboard. This needs to include, all small wiring, all connections and joints, CT's,					12			Nov '08	
	Replace the existing old ACB's (ABB Novomax) with new ABB Megamax range. The retrofit work will not require primary busbar modifications and would require minimal									-
17	down time for installation. The new ACB's can be fitted with replacement castell interlocks with same symbols.					12			Nov '08	
18	Test and verify the condition of the changeover contactor mechanism and replace them if found to be defective.					12			Nov '08	
19	Clean and test all internal parts and components e.g., Bus bar's, terminal connections, etc.				_	12			Nov '08	
20 21	Undertake necessary repair paintwork of the switch covers Control panel left open				-	12		Dec '08	Nov '08	+
22	Electrical safety signage is on the floor plant room which requires cleaning					10			Nov '08	
	Ventilation									
23	No inspection reports					12			Nov '08	
24	No commissioning data					12			Nov '08	
25	PPM's for Legionella outstanding				_	18		Dec '08	N	
26 27	WFL cleaned and disinfected May 08 (only AHU's) – JAS FM to take onboard Fire dampers were not maintained - i.d notices not in place – no markings on ductwork				-	12 18		Dec '08	Nov '08	+
28	Commissioning – Don't know JAS FM still verifying information					10			Nov '08	
29	Pressure differential switches hanging off					12			Nov '08	
	Water Management									
30	Issues – Roof water tanks main valves letting-by so unable to drain down and carry out tank cleaning/chlorination, repaint and refurbishment.					18		Dec '08		
31	Log Book are across 3 volumes and the records are very confusing					12			Nov '08	
32 33	PPM System and policy unavailable. Command system software for PPM – little planning.				-	12			Nov '08 Nov '08	
34	Responsible person – out of date due to vacancy - left Feb 2007.					12			Nov '08	
35	Potable water training None found					12			Nov '08	
36	Drinking water work on systems, UV PPM contracted out to GB Environmental no evidence of contract.					12			Nov '08	
37	Medical monitoring of staff - no evidence found					6 12			New 100	Oct '08
38 39	Central Treatment – A Block by UV (switched off during visit) No confirmed service records or logs for GB Environmental The Cold water booster pumps are triplex in parallel and could stagnate if not regularly switched on					6			Nov '08	Oct '08
40	The Cold watch booster pumps are chosen and cold stagnate in orchopating since february. HWS - temps checked weekly, there was little evidence of an vecords since February.					18		Dec '08		000 00
41	Calorifiers temp records were not up to date					12			Nov '08	
42	L Block Phase 2 - Day Treatment Centre - at least 1 outlet not achieving temperature, no action taken?				_	18		Dec '08		
43 44	Couple of dead-leg issues – mainly from hand-over. 5th Floor L Block has no TMV's but signage was in place indicating that there were TMV's				_	12 18		Dec '08	Nov '08	+
44	No LST radiators fitted in L Block, Risk Assessment required					18		Dec 08	Nov '08	
46	1 medical bath – No Cat 5 break-tank					12			Nov '08	
47	CWS – Tank room temperature an issue due to the thermal gains from medical air/vacuum plant. Mains water normally in-coming at temperatures greater than 20 Deg C +					12			Nov '08	
	JASFM expressed concerns in the event of a hot summer									
48 49	Tank through put was unknown Tanks on roof low water was observed and the soft water were warm.					12 18		Dec '08	Nov '08	+
50	Water softener observed dry (salt in bottom dry)					18		Dec '08		+
51	Emergency Plans were not available					12			Nov '08	
52	No calibration certificates for any temperature test instruments					12			Nov '08	
53	No recent records of flushing little use outlets and shower head cleaning					18		Dec '08		+
54 55	The Water Specialist sub-contractors have not been undertaking or recording a number of their maintenance tasks CWS and Soft water tanks external on roof require cleaning and disinfection					12 18		Dec '08	Nov '08	+
56	Schematic diagram has been manually altered and needs updating L Block Plant Room 10					6		200		Oct '08
57	Loose lids on CWS tanks					18		Dec '08		
58	Chem Aqua Service report indicating high TVC counts in 3 areas in Monkiski Ward no remedial works shown or recorded					18		Dec '08		<u> </u>
59 60	Contractor unable to drain break tanks in basement due to blocked drains no remedial works sited Microbiological readings birds on Ifer Ward now results for recommended to complex observed as indicates					18		Dec '08 Dec '08		+
60	Microbiological readings high on lfor Ward now results for recommended re-samples observed as indicated Last chlorination certificate observed 2005					18		Dec '08		+
	Bacteriological tests results indicated high reading for Nightingale Ward no remedial action noted					18		Dec '08		+
62	Bacteriological tests results indicated high reading for reception Gents toilet no remedial action noted					18		Dec '08		
63									1	
63 64	Large number of temperature checks omitted due to no access					12			Nov '08	
63	Large number of temperature checks omitted due to no access Last legionella risk assessment shows action list no reports of any remedial actions High pressure alarm on CHW pressurisation unit					12 18 12		Dec '08		



Whittington Hospital NHS Trust DDCA Action Plan

	Action No.	Risk (Responsibility) Probability and Impact Criteria Values								
Ref		JAS FM/WFL	Trust High	Medium	Low	Score	Action		Review Date	te
P	Aedical gases and Bedhead services									
68 N	lo evidence of PPM since 27/03/08					18		Dec '08		
	lo evidence of close out of recommended actions/faults					12			Nov '08	
	rust Designated Person not known Iot all changes have been made to transfer to HTM 02-01				-	12 12			Nov '08 Nov '08	
	AGSS pump faulty removed and not repaired					12			Nov '08	
	/ledical gas key cabinets unlocked					12			Nov '08	
	ondensate traps held on with insulation tape ifts					18		Dec '08		
	In solution of the second s					12			Nov '08	
In	surance recommendations were not being carried out and were still outstanding on the next annual inspection the insurance inspector had rendered the lift unusable by					18		Dec 108		-
	witching it off on the car top controls JASFM reported that the faults were subsequently repaired							Dec '08		
77 W	Veekly lift check were not recorded every week					12			Nov '08	
78 Li	ifting beams – Yes. How are these managed for SWL? Not managed at present, suggested do not use notices and for lift engineers to certify if required to use.					12			Nov '08	
79 A	re all lifts compliant answer unknown					12			Nov '08	
80	sspection reports indicated a number of outstanding serious defects to be repaired in one month but no written confirmation was observed - ref Allianz Cornhill					18		Dec '08		
E	31893005652 dated 11 th April 2007									
	anding door guides were found to be missing and slack rope switch missing to be remedied within one month no indication of remedial work - ref Allianz Cornhill 31893007531)					18		Dec '08		
	lealth and Safety and Statutory Compliance								·	
82 N	Io confined space register					12			Nov '08	
83 N	Aark Woodham has H&S training No others.					12			Nov '08	
	Io written policy/procedure for lone working					12 6			Nov '08	Oct '08
	Io Occupational medical screening carried out other than initial induction sign-off Io emergency stops for machinery in workshops					12			Nov '08	000
	o Cleaning policy/procedure in workshops					12			Nov '08	
	eg 14 – glazing in L. Block needs assessment					12			Nov '08	
	Annual Handling – not all staff trained					12			Nov '08 Nov '08	
	1edical Air Compliance – no PPM since March 08 Io Contingency/Disaster recovery plan					12 12			Nov '08	
	ngineering Procedure Policy statement not signed					12			Nov '08	
e	ias									
	lo permits to work used on gas systems however pressure systems permits used on gas boiler used.					12			Nov '08	
	raining Matrix being developed as data base for all essential training Io close out for modifications to systems and update of drawings					6				Oct '08 Oct '08
	to crose out for modifications to systems and update of drawings					12			Nov '08	
	ressure Systems						·			
т	he insurance inspections identified a number of risk assessments with associated recommendations for improvement, during the audit it was not apparent that these									
97	commendations had been acted on. JAS FM to check and provide confirmation that they had noted and actioned these recommendations					6				Oct '08
	ira									
98 Fi	ire Risk Assessments completed for JAS FM Areas only, this needs to be coordinated with the Trust					6				Oct '08
	ked wiring in progress outstanding in theatres and main LV switch panel.					12			Nov '08	
	AS FM have not seen the Trust Fire Policy					12			Nov '08	
	ienerally housekeeping in the hospital was reported as poor by JAS FM Io signage in lifts (DO NOT USE IN THE EVENT OF FIRE)					12 12			Nov '08 Nov '08	
	lo emergency lighting on Wards in L Block					12		Dec '08	NUV US	-
104 H	ose reels still installed, but supply tank etc disconnected could lead to confusion for fire fighters as notices were still displayed					18		Dec '08		-
	lo records of fire awareness training					12			Nov '08	
	mergency light testing – not entered in Fire Log Book ire door/exit maintenance – not entered in Fire Log Book					18 12		Dec '08	Nov '08	+
	ire door/exit PPM – not entered in Fire Log Book No PPM carried out		<u> </u>			12			Nov '08	
109 Fi	ire Extinguishers maintenance – not entered in Fire Log Book					12			Nov '08	
	ire doors removed and not repaired immediately					18		Dec '08		
-	ieneral La formativata investo formativa a da falanzia a fa RNA ana da				1				N. 1	
	to formal indexing and referencing system for recording and safekeeping of PPM records; ittle or no evidence of written specific site procedures/signed task sheets;		<u> </u>			12 12			Nov '08 Nov '08	
	ittle or no evidence of written specific site procedures/signed task sneets; ittle or no evidence of specific persons signed off to work on a particular element;					12			Nov '08	
114 N	o evidence of current contracts with external contractors; (one exception – PMG)					12			Nov '08	
	ittle or no evidence of recent PPM's;					12			Nov '08	
	ittle or no evidence of recent work sheets/log sheets/closed off work; ittle or no evidence of external contractors work, verified and signed off by JAS FM;		—— ——			12 12		-	Nov '08 Nov '08	
	to plant room log books;					12			Nov '08	
119 N	lo evidence of plant room checks;					12			Nov '08	
	lo procedure for recording system modifications/updating drawings;					6			N. 100	Oct '08
121 N	Io evidence of staff training matrix; ieneral condition of flooring very poor and hazardous in some areas					12 18		Dec '08	Nov '08	+
							1	500 00	New 100	+
122 G	ead flashing detail to flat roof children's area present a risk from failure		l l	1		12			Nov '08	
122 G 123 Le 124 D	ead flashing detail to flat roof children's area present a risk from failure Irainage blocked by discarded toys and footballs thrown from play area Iashing detail detached on flat roof					12 12 12			Nov '08 Nov '08	

